

SLW-8802-1.5 (SLW-4512-WINDS-1.5) Two Handle Widespread Lavatory Faucet Installation Guide



Model Numbers

☐ SLW-8802-1.5

Two Handle Widespread Lavatory Faucet

Warranty

Limited Lifetime - to the original end purchaser in consumer/residential installations.

5 Years - for industrial/commercial installations. Refer to www.symmons.com/warranty for complete warranty information.

Specification

Two Handle Widespread Lavatory Faucet featuring 8"-16" mounting configuration shall include ceramic cartridges, 3/8" copper supplies, 1/2" IPS inlet connections, metal drain assembly and 1.5 gpm (5.7 L/min) aerator. Faucet shall be made from metal construction, plated in standard polished chrome finish.




Compliance

-ASME A112.18.1/CSA B125.1

-NSF/ANSI 61.9. NSF/ANSI 372




Dimensions

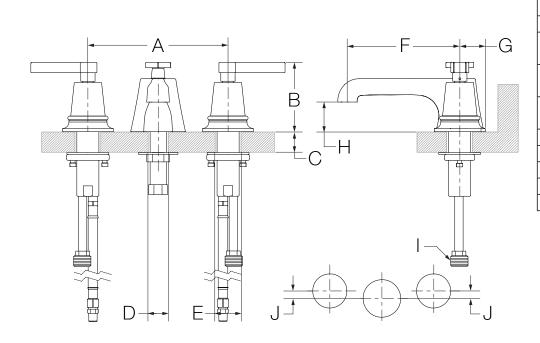

Measurements				
Α	8", 203 mm			
В	(2x) 3-3/8", 86 mm			
С	Deck Thickness Ref.			
	Max. 1-3/8", 35 mm			
D	Hole Size			
	Max. Ø 1-3/4", 44 mm			
Е	Hole Size			
	Max. Ø 1-1/2", 38 mm			
F	5-1/2", 140 mm			
G	1-1/4", 32 mm			
Τ	1-1/2", 38 mm			
	1/2-14 NPSM			
J	3/16", 5 mm			

Note: Dimensions subject to change without notice.

Parts Breakdown

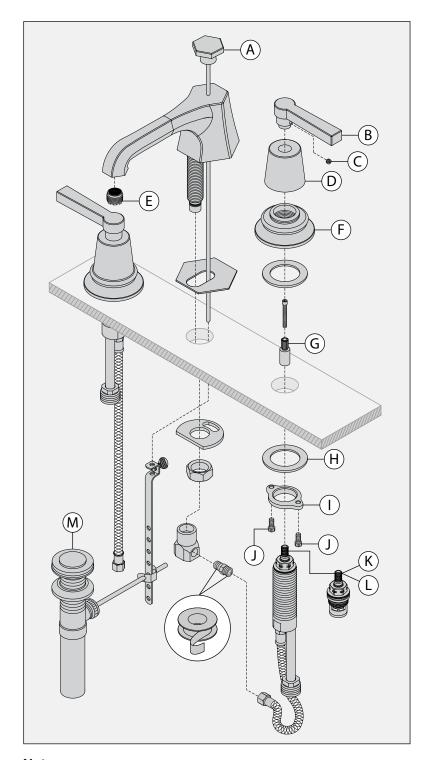

Replacement Parts				
Item	Description	on	Part Number	
Α	Lift Rod		RL-230	
В	Handle		RL-008	
С	Set Screw		NL-000	
В	Handle			
D	Escutcheon		WSF-WCW-KIT	
F	Flange		VVOI -VVOVV-IXII	
G	Cartridge Adapter			
D	Escutcheon		RL-012	
F	Flange			
G	Cartridge Adapter			
E	1.0 Aerator		FLR-130-1.0-KIT	
	1.5 Aerato	r	FLR-130-1.5-KIT	
Н	Washer			
	Mounting N		RL-187	
J	Mounting Sci	ews		
K	Cold Cartridge		KN-113	
L	Hot Cartridge		KN-114	
М	Metal Drain		RL-154LR	
Tools Required for Installation				
Adjus	table Wrench			
	en Wrench: dle (2.5 mm)			
1	illips Head crewdriver			
Plu	mber Putty			
Plu	ımber Tape			
	Silicone			

Notes:

- 1) Apply a bead of silicone around the perimeter of trim installed flush to sink.
- 2) Apply plumber tape to all threaded connections.

▲ WARNING: This product can expose you to chemicals including lead, which is known to the state of California to cause cancer, birth defects, or other reproductive harm. For more information, go to www.P65Warnings.ca.gov.